



97-25, *Publication Date: DECEMBER 8, 1997*

<ul style="list-style-type: none">• Blower Motor - "Chirping" Or "Squeaking" From Blower Motor At Low Speeds• Noise - "Chirping" Or "Squeaking" From Blower Motor At Low Speeds	Article No. 97-25-5
--	--------------------------------

FORD:

1984-94 TEMPO
1986-97 TAURUS
1989-97 THUNDERBIRD
1991-97 ESCORT
1994-97 MUSTANG
1995-97 CONTOUR

LINCOLN-MERCURY:

1984-94 TOPAZ
1986-97 CONTINENTAL, SABLE
1989-97 COUGAR
1991-97 TRACER
1993-97 MARK VIII
1995-97 MYSTIQUE

LIGHT TRUCK:

1992-97 AEROSTAR
1993-97 VILLAGER
1995-97 WINDSTAR
1997 EXPEDITION, F-150, F-250 LD

This TSB article is being republished in its entirety to correct the supersede article reference.

ISSUE:

Some vehicles may exhibit a "squeaking" or "chirping" from the blower motor at low blower motor speeds. This may be caused by uneven brush friction on the commutator surface of the motor.

ACTION:

Replace the blower motor with a revised blower motor which has improved brush-to-commutator friction. Refer to the appropriate model/year Service Manual for removal and installation procedures.

PART NUMBER	PART NAME
F4DZ-19805-CA	A/C Blower Motor (1986-94 Taurus/Sable, Continental)
F6DZ-19805-CA	A/C Blower Motor (1995-97 Taurus/Sable)
F7OZ-19805-BA	A/C Blower Motor (1995-97 Continental)
F4SZ-19805-HA	A/C Blower Motor (1989-97 Thunderbird/Cougar, 1993-96 Mark VIII)
F7LZ-19805-CA	A/C Blower Motor (1997 Mark VIII)
F7CZ-19805-EA	A/C Blower Motor (1991-97 Escort/Tracer)
F7ZZ-19805-BA	A/C Blower Motor (1994-97 Mustang)
F43Z-19805-JA	A/C Blower Motor (1984-94 Tempo/Topaz)
F7RZ-19805-DA	A/C Blower Motor (1995-97 Contour/Mystique)
F68Z-19805-FC	A/C Blower Motor (1995-97 Windstar) - Front
F78Z-19805-BA	A/C Blower Motor (1995-97 Windstar) - Rear Auxiliary
F49Z-19805-A	A/C Blower Motor (1992-97 Aerostar) - Front
F6XZ-19805-BA	A/C Blower Motor (1993-97 Villager) - Front
F49Z-19805-C	A/C Blower Motor (1992-97 Aerostar, 1993-97 Villager) - Rear Auxiliary
F75Z-19805-FA	A/C Blower Motor (1997 F-150/F-250 LD, Expedition) - Front
F75Z-19805-EA	A/C Blower Motor (1997 Expedition) - Rear Auxiliary

OTHER APPLICABLE ARTICLES: NONE

SUPERSEDES: 97-23-4, 97-6-10

WARRANTY STATUS: Eligible Under The Provisions Of Bumper To Bumper Warranty Coverage For 1992-97 Model Year Vehicles And 1991 Continental, Basic Warranty Coverage For All Other Model Year Vehicles

LABOR ALLOWANCE

OPERATION	DESCRIPTION	TIME
972505A	Replace Blower Motor - All Vehicles	Refer to SLTS Manual

DEALER CODING

BASIC PART NO.	CONDITION CODE
19805	14

OASIS CODES: 208000, 208300, 208999, 702000, 702300
